

# UNITOP



## Clamping unit for spigot saddles SA UNI / ASA UNI

The UNITOP clamping unit is required for the assembly of:

- FRIALEN outlet spigot saddles Universal SDR 11
  - SA UNI d 250 - d 900 with outlet d 90, d 110, d 125 and d 160
- FRIAFIT outlet spigot saddles SDR 17
  - ASA UNI d 630 - d 900 with outlet d 160

The UNITOP 250 clamping unit is required for the assembly of:

- FRIALEN outlet spigot saddles Universal SDR 11
  - SA UNI d 315 - d 1200 with outlet d 225 and d 250

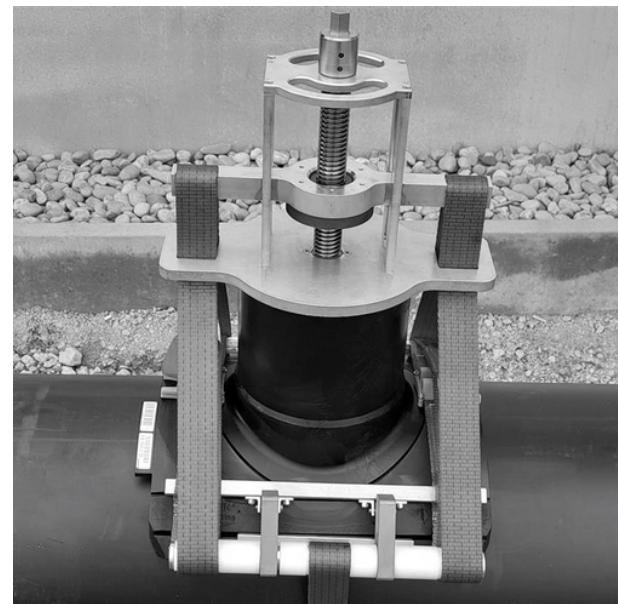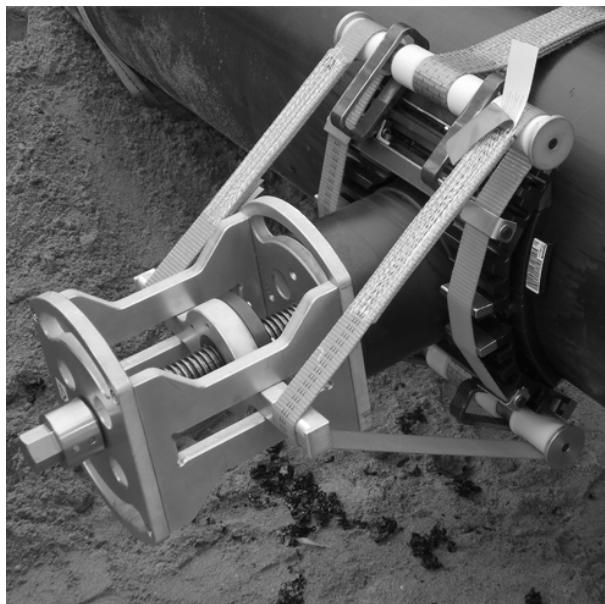

Reference	Short text	Weight [kg]	BX	Pallet quantity
613385	UNITOP clamping device from d 250 - d 900 with outlet up to d 160	24,800	1	5
613387	UNITOP 250 clamping device from d 315 - d 1200 with outlet d 225/d 250	24,800	1	8
613241	ADWL elbow adaptor for socket contacts 4.0 mm	0,200	1	-
613839	Clamp adaptor for the outlet of the ASA UNI d 160 spigot saddles	2,200	1	20

# UNITOP

## Clamping unit for spigot saddles SA UNI / ASA UNI

### Application

The UNITOP clamping unit for mounting FRIALEN outlet spigot saddles Universal SDR 11 SA UNI d 250 - d 900 with outlet d 90, d 110, d 125 and d 160, as well as for mounting the FRIAFIT outlet spigot saddles SDR 17 ASA UNI d 630 - d 900 with outlet d 160.

The UNITOP 250 clamping unit for mounting FRIALEN outlet spigot saddles Universal SDR 11 SA UNI d 315 - d 1200 with outlet d 225 and d 250.

Pressure test adapter FWDPA SA with self-tapping thread for use with SA UNI and ASA UNI spigot clamps for carrying out a pressure test before tapping with 1/2" external thread for connecting a pressure test device, e.g. via a commercially available plug-in coupling.

The FWAB drilling equipment for tapping PE-HD pipes in a depressurised state through the outlet of SA UNI and ASA UNI.

Processing on pipes under operating pressure: For tapping under operating pressure, please contact our application technology department on +49 (0)621 486-1486.

In conjunction with the UNITOP clamping device (not required for UNITOP 250!), additional ADWL angle adapters for 4.0 fusion socket contacts are required for fusion units equipped with straight fusion plugs (order no. 613241). Not required for FRIAMAT fusion units.

### The decisive difference

The right tools make all the difference on the construction site. As professionals in the electrofusion process for PE-HD pipe systems, we have therefore developed the right tools and accessories for you right from the start.

### Good reasons for the UNITOP and UNITOP 250 clamping units and for the FWAB drilling equipment:

- Cross-dimensional processing of outlet spigot saddles Universal SA UNI / ASA UNI with only one clamping unit (UNITOP or UNITOP 250)
- Solid clamping unit suitable for construction sites with extra wear-resistant components for a long service life
- Simple and safe installation with UNITOP or UNITOP 250 clamping unit (Balanced-Loading)
- Clear and safe indication for the correct clamping (preset torque wrench)
- Before tapping the pipe, a leak test can take place with the pressure testing device FWDPA SA (not for ASA UNI)
- Tapping under pressure with shut-off element without interrupting operations is possible
- Burr-free and almost flush tapping for maximum hydraulic performance
- The drilled PE piece is held securely by the FWAB drilling equipment so that it cannot fall into the pipe
- Supplied in a solid aluminium transport box